

NOTES:

- Field work was performed on 12/18/2018.
- Monroe County Surveyor's Field Book 52, page 70.
- Project Name: 2018-003_VRS-Network, Field work by: RSO & CAR, Drawn by: RSO, Reviewed by: RSO, TER & SRB.
- The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83_NO_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Distances obtained with GPS have not been adjusted to ground. Coordinate data was collected with a Javad Triumph LS Network Rover and a Sokkia Set 510 Total Station.
- Vicinity sketch was compiled per 2014 aerial orthophotography.
- This monument was witnessed by the Monroe County Surveyor, Kevin Enright, on May 28, 2010 and officially entered into the Monument Record on November 24, 2010. We collected coordinates on the known monument in preparation for an upcoming construction project in the area. Historic research has not yet been performed to prove the validity of this monument.
- This monument was set by Bledsoe Riggert Guerrettaz in 2009 under the supervision of Bernie Guerrettaz at the intersection of opposite quarter corners as shown on an unrecorded boundary survey for Bruner on file in the Monroe County Surveyor's Office as Reference Survey ID 002828.

WITNESS MONUMENT TIES			
ID	BEARING	DISTANCE	DESCRIPTION
Witness A	N 65d E	21.5'	Monroe County "PROTECT NEARBY SURVEY MARKER" sign found 3.3' above grade on the east side of a t-post in a north/south fence.
Witness B	S 31d E	40.3'	Mag nail and washer set 0.5' above grade on the west side of a 3" x 4.5" wood mailbox post for #6455 N Showers Road
Witness C	S 82d W	20.5'	$\frac{3}{4}$ " iron pipe found 0.1' above grade next to u-post
MONUMENT ACCESSORIES			
Other survey grade monuments that were located in the vicinity and their relation to the monument.			
(#10539)	N 35d44'26" W	40.89'	$\frac{5}{8}$ " rebar with yellow plastic cap stamped "BLED SOE TAPP PC5029200004" found 0.4' above grade on the east side of a t-post

▲ **Monument Description:** Mag spike found flush in the south bound lane of Showers Road

State Plane Grid Coordinates: Point No.:10532 Northing: 1455996.3', Easting: 3109728.3'

SHEET 1 OF 2	MONUMENT RECORD CORNER ID: Blm_K03	Center 1/4 Corner Section 04- T09N-R01W Bloomington Township Monroe County, Indiana	 OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	--------------------------------------------------------	-----------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Photos were taken on 12/18/2018 with an iPhone 6s



Trohn Enright-Randolph
Trohn Enright-Randolph
Monroe County Surveyor

Accepted by the Monroe
County Surveyor Review Board
on 9/10/2019

Rachel Oser
Rachel Savich Oser, State of Indiana
Professional Surveyor No. 21100022

SHEET
2
OF
2

MONUMENT RECORD
CORNER ID:
Blm_K03

Center 1/4 Corner
Section 04- T09N-R01W
Bloomington Township
Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
Trohn Enright-Randolph Monroe County Surveyor
Rachel Savich Oser Professional Surveyor
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 4

Township: 9 North


Range: 1 West

Corner ID: Blm K-03

Monument Description & Remarks: 3" MAG Spike (set) replaced MAG nail. Survey Sign 4.5ft above ground at pt. B


References On File: Bernie Guerrettaz survey, Bruner Minor Subdivision (2010), on file in Recorder Office cabinet D, envelope 96

RECOVERY TIE DRAWING
Field Book 44 Page No. 12

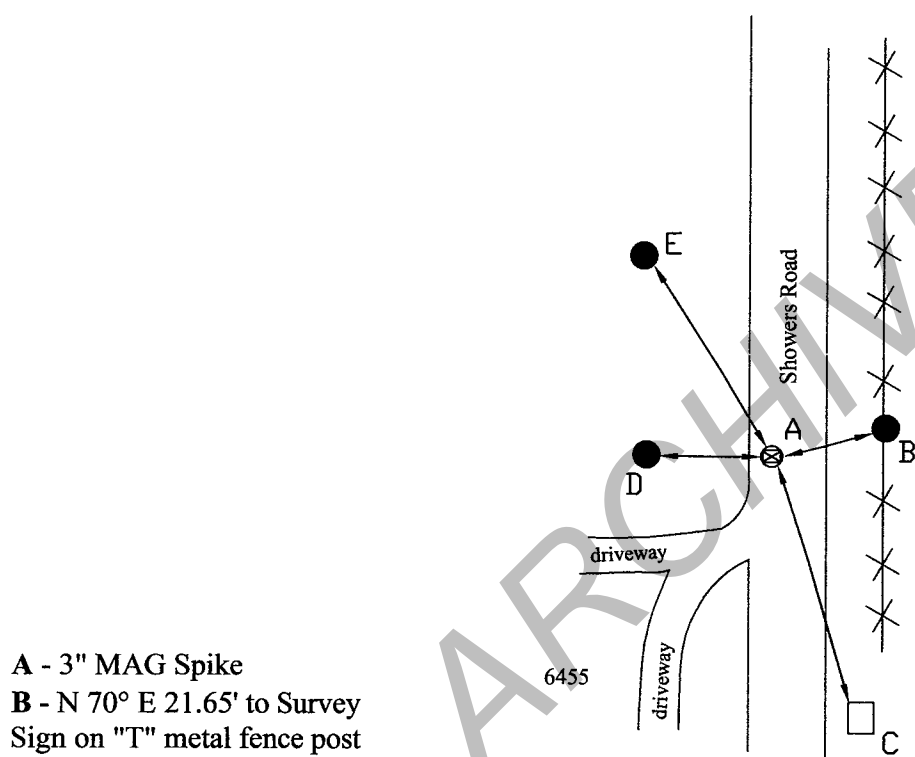

- A - 3" MAG Spike
- B - N 70° E 21.65' to Survey Sign on "T" metal fence post
- C - S 27° E 40.46' to MAG nail in 3"x5" mail box wood post
- D - S 88° W 20.52' to 3/4" Iron Pipe
- E - N 31° W 41.00' to 5/8" Rebar

Not To Scale
Compass Bearing Magnetic North

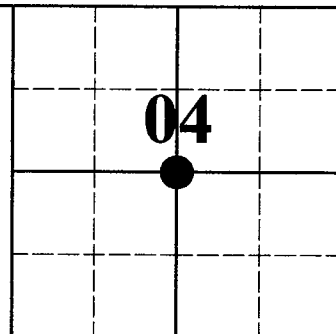

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 28th day of May, 2010.



Administered by the Monroe County Surveyor Review Board

Date: 11/24/2010